



VTOKY, KLBOVÉ LOŽISKÁ, PUZDRÁ

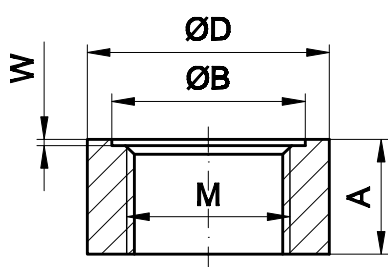


Návarok s metrickým závitom

M	12x1.5	14x1.5	16x1.5	18x1.5	20x1.5	22x1.5	27x2	33x2	
ØB	16	18	20	22	24	27	32	39	
ØD	20	22	25	28	28	32	40	50	
A	14	14	14	16	16	18	19	22	
W	0.5	1	1	1	1	1	1	1	

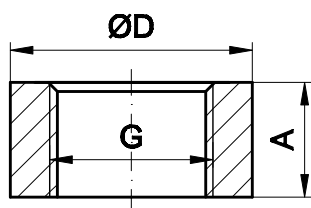


Návarok s rúrkovým (trubkovým) závitom

G	G1/4"	G3/8"	G1/2"	G3/4"	G1"	
ØD	25	25	32	40	50	
A	14	14	18	19	22	

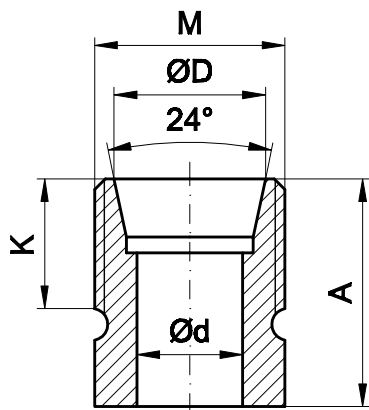

Hrdlo s metrickým závitom


M	12x1.5	14x1.5	16x1.5	18x1.5	20x1.5	22x1.5	24x1.5	27x2	
Ød	5	6	8	10	10	12	14	16	
ØD	8.1	10.1	12.3	14.3	14.3	17.3	18.3	20.3	
A	14	16	18	20	20	22	24	28	
K	7	8	10	12	12	14	16	14	

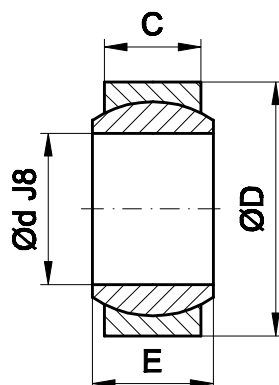

Kľbové ložiská typu GE

Ød	20	25	30	35	40	45	50	60	70
ØD	35	42	47	55	62	68	75	90	105
C	12	16	18	20	22	25	28	36	40
E	16	20	22	25	28	32	35	44	49
označ.	GE20	GE25	GE30	GE35	GE40	GE45	GE50	GE60	GE70

Doporučená tolerancia čapu pre otvor □d je h6

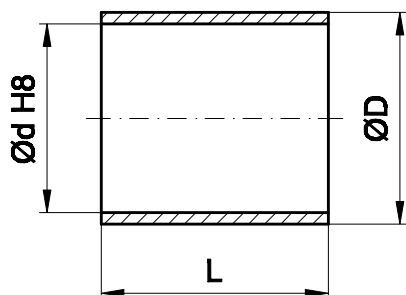

Ložiskové puzdrá typu KU a KX

Ød	20	25	30	35	40	45	50	55	60	65	70	75	80
ØD	23	28	34	39	44	50	55	60	65	70	75	80	85
L	10 30	15 30	20 40	20 50	20 50	30 50	30 60	40 60	40 60	40 60	40 80	40 80	40 80

Doporučená tolerancia čapu pre otvor □d je f7 - pre KU

Doporučená tolerancia čapu pre otvor □d je h8 - pre KX

Dĺžky L: 10,15,20,25,30,40,50,60,70,80