


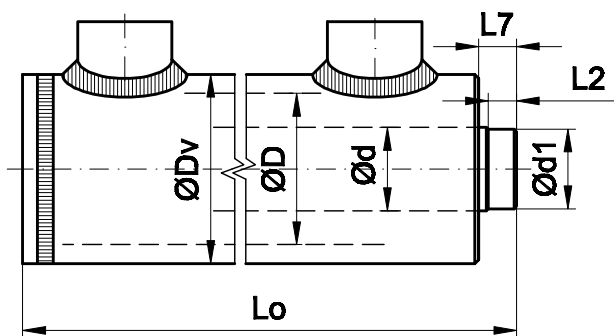


Bez upínacej časti

Prev. 0

Ød	18	22	25	28	32	36	40	45	50	55	63	70	80	90
Ød1	17.5	21	24.5	27	31	35	39	44	49	54	62	69	79	89
L2	6.5	6.5	7.5	7.5	6.5	6.5	9.5	9.5	9.5	12.5	16.5	16.5	16.5	16.5
L7	10	10	10	10	11	11	12	15	15	17	22	20	20	20

Rozmery sú odporúčané

Príslušný NAK: XXXAXX0

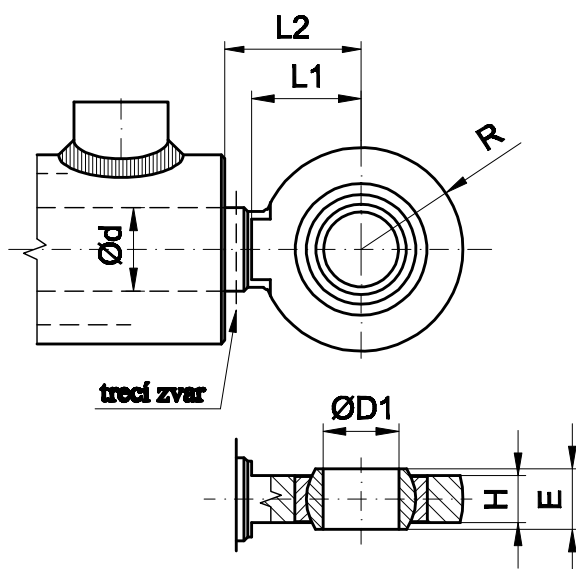

Zvarené oko s kľbovým ložiskom


Prev. 1

Ød	18	22	25	32	40	45	50	55	63	70
ØD1	20	20	25	25	30	35	40	45	50	60
L1	24	29	34	38	42	53	58	64	69	77
L2 min.	40	36	39	46	47	73	83	88	102	110
R	27	27	32.5	35	40.5	47	51	60	61	80
E	16	16	20	20	22	25	28	32	35	44
H	13	13	17	17	19	24	25	28	32	38

Iba priemery Ød - 22, 25, 32, 40 sú zvarené treťím zvarom

Rozmery sú odporúčané

Príslušný NAK: XXXAXX1

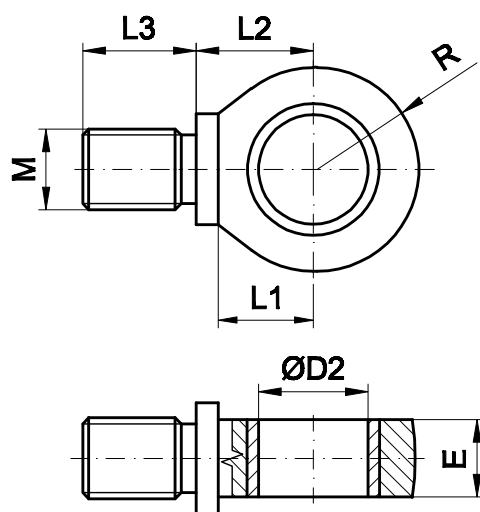

Oko s ložiskovým puzdom


Prev. 2

ØD2	30	35	40	45	50	60	70	80	
L1	29	37 40	41	50	60	60	65	75	
L2	29	37 40	45	58	68	71	80	90	
L3	30	32 34	45	42	52	50	60	60	
R	27	31 35	40.5	47	52	56	61	72.5	
E	25	25	30	30	40	40	50	50	
M	16x1.5	18x1.5 24x1.5	30x2	33x2	36x2	42x2	48x2	52x2	

Rozmery sú odporúčané

Príslušný NAK: XXXAXX2

Rozmery Lo, Dv podľa jednotlivých typov hydromotorov

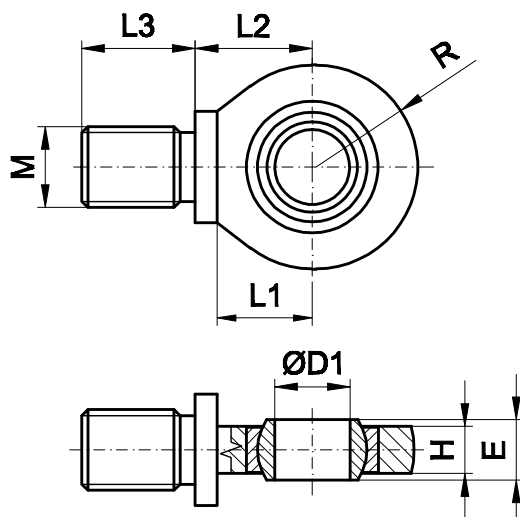


Skrutkované oko s kľbovým ložiskom Prev. 3

ØD1	20	25	30	35	40	45	50	60	
L1	29	37 40	41	50	60	60	65	75	
L2	29	37 40	45	58	68	71	80	90	
L3	30	32 34	45	42	52	50	60	60	
R	27	31 35	40.5	47	52	56	61	72.5	
E	16	20	22	25	28	32	35	44	
H	13	17	19	22	24	27	30	38	
M	16x1.5	18x1.5 24x1.5	30x2	33x2	36x2	42x2	48x2	52x2	

Rozmery sú odporúčané

Príslušný NAK: XXXAXX3

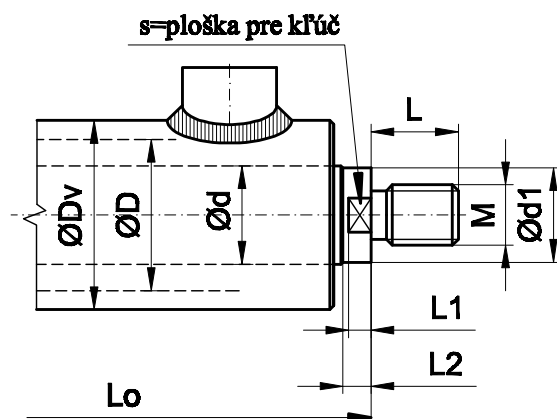


Vonkajší závit na piestnici Prev. 4

ØD	40	50	63	80	90	100	110	125	140
Ød	22	25	32	40	45	50	55	63	70
	25	28	36	45	50	55	63	70	80
	28	32	40	50	55	63	70	80	90
L	22	30	30	45	45	45	50	63	80
M	16x1.5	18x1.5	24x1.5	30x2	33x2	36x2	42x2	48x2	52x2

Rozmery sú odporúčané

Príslušný NAK: XXXAXX4

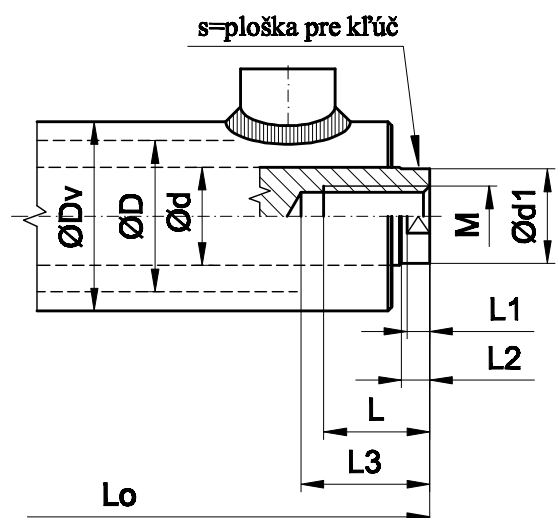

Vnútorý závit v piestnici Prev. 5

ØD	40	50	63	80	90	100	110	125	140
Ød	22	25	32	40	45	50	55	63	70
	25	28	36	45	50	55	63	70	80
	28	32	40	50	55	63	70	80	90
L	35	36	46	51	45	55	55	65	65
L3	45	46	56	61	55	65	65	75	75
M	16x1.5	18x1.5	24x1.5	30x2	33x2	36x2	42x2	48x2	52x2




Rozmery sú odporúčané

Príslušný NAK: XXXAXX5

Rozmery Lo, Dv podľa jednotlivých typov hydromotorov

UKONČENIE PIESTNICE

Prevedenia podľa NAK-u

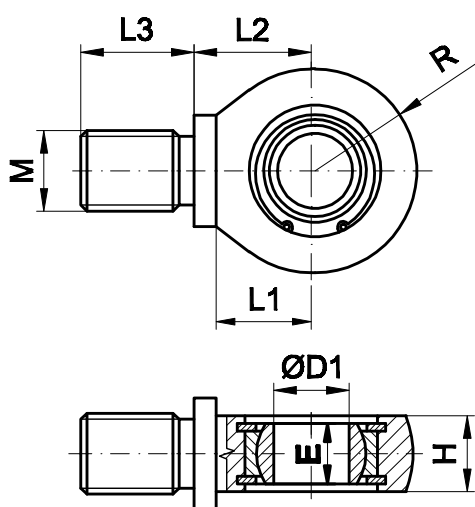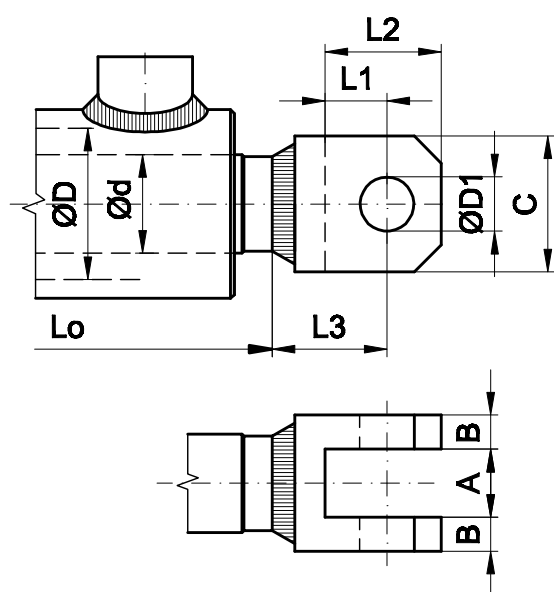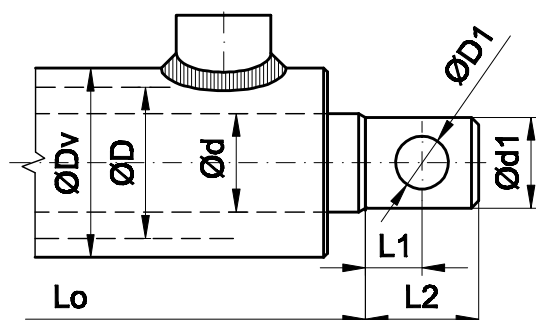

Otvor kolmo cez piestnicu

Prev. 6

ØD	40	50	63	80	90	100	110	125	140
Ød	22	25	32	40	45	50	55	63	70
	25	28	36	45	50	55	63	70	80
	28	32	40	50	55	63	70	80	90
Ød1	21	24	31	39	44	49	54	62	69
	24	27	35	44	49	54	62	69	79
	27	31	39	49	54	62	69	79	89
ØD1	12	14	18	22	24	25	28	30	35
	14	16	20	24	25	28	30	35	40
	16	18	22	25	28	30	35	40	45
L1	16	20	25	30	35	40	45	50	55
L2	32	40	50	60	70	80	90	100	110

Rozmery sú odporúčané

Príslušný NAK: XXXAXX6

Vidlica

Prev. 7

ØD	40	50	63	80	90	100	110	125	140
A	16	20	24	32	36	40	44	50	56
B	8	10	12	16	18	20	22	25	28
C	40	50	60	80	85	95	100	115	130
ØD1	20	25	30	40	45	50	55	60	70
L1	25	32	38	50	56	60	65	75	80
L2	41	52	62	82	92	100	110	125	135
L3	45	55	65	85	95	100	110	125	135

Rozmery sú odporúčané

Príslušný NAK: XXXAxx7

Klíbové ložisko poistené segerkami

Prev. 8

ØD1	20	25	30	35	40	45	50	60	
L1	29	37 40	41	50	60	60	65	75	
L2	29	37 40	45	58	68	71	80	90	
L3	30	32 34	45	42	52	50	60	60	
R	27	31 35	40.5	47	52	56	61	72.5	
E	16	20	22	25	28	32	35	44	
H	20	26	28	32	34	38	42	50	
M	16x1.5	18x1.5 24x1.5	30x2	33x2	36x2	42x2	48x2	52x2	

Rozmery sú odporúčané

Príslušný NAK: XXXAxx8

Rozmery Lo, Dv podľa jednotlivých typov hydromotorov